Run Date: 11/10/2005

EB RAMS Case Management

CASE REPORT EB-05-DV-538

3 HRS Spent on	30N36		CIACIA CAGAIC	. A. A.J. V O.	,			
Utility Field:	onfidential 🏻 Congressiona			Suspense Date	11/9/2005	:		
Start Date 11/9/2		u Uniicensed	Local#	Status	CLOSED	<u>. </u>		
Start Date (1/9/2			Local#		gged by	•		7.
Name /	COMPLAINANT			SUBJECT	•	Activity	Enforcemen Resolution	t - Interference
Company Address						Project	Unintentiona Part 15B	al Radiators
City		AND AND DESCRIPTION OF THE PROPERTY OF		FL		ActCode	30N36	
Pri Phone	Fax	positive establishments	Pri Phone	Fax		3		
Alt Phone .	**************************************		Alt Phone	-		Action P	lan Involved	Not a WSR
Call Sign	Freq 29	.1000 MHz	Call Sign	Freq	29.1000 MHz			Item
Xmtr City	State	Twr#	Lat	Long		Rule Par	t 15B	
·		GENERAL CAS	E DESCRIPTION		elementational temperature de service de service de principal de la fait de la fait de la fait de la fait de l	ai		
C-Alt Contact sengineer for State of Colorado work # 303-866-2412						☐ Information Transfer☑ Comm Prob Resolution		
C-Alt Call or ID	э үч мэл хэтэр эт т (могт Алья). На Авган хотаа авга хотаа авга хова хова үч нь 1976 - 1976 он 1970 он 1970 он 1	· · · · · · · · · · · · · · · · · · ·	от операти повечнику и при композия в Аладом В. С. 2002 г. п. 1 досто и В операт отности утогору в руковор	мара (должини (1936) Ч.44 ССУ Ал Можей вы обще в присод надаговирание в от решей уча	a 1949 PP (1966) VP 1967 (1964) de 1894) Zaleskof (1964) by analysis and analysis (1964)	HFDF	Rearing	
S-Contacts					☑ Inquiry/Complaint			
Tower Owner:						☑ Investigation		
Other Site Info:						Inspection .		
						_		
Problem IX to 20-30 MHz and VHF 144-148 MHz. Think is house in back of COMP. Did circuit breaker test on satellite dish but IX did not go away. Did not do circuit breaker test of whole house.						Jaiety	•	
			RULE VIOLATIONS	n der hande der eine Aukum zu Ar (2001) von 144 jet. Aphylydd i lladd hywno denny benneur a I	a section of the sect			
Rule Vi	olation Violation Dat	e Issue Date	Notice Type	•				
15.5(b)	11/9/200	05 11/9/2005	WARNING VERB					
 4 Section Consistence of the Consisten			WORK EVEN	TS	And the first of the first William State (1975) and the first of the f	and the second s		
Event Date Age	ent Event Type	Trave IN OUT Cos	el t Pi	roblem Resolution	,	uan	•	
11/9/2005	OPEN/CLOSED 1	.0 2.0	Wed 11/9/05 4:15	ppm mst				

Run Date: 11/10/2005

CASE REPORT EB-05-DV-538

IX was coming from external switching power supply for Sunbeam Model C1 electric blanket. Was twin size or full size blanket. Power supply ran on 120 vac and went down to 18vdc. Power supply made in China UL listing E200304 and 335M On/off circuit breaker tests with Same and determined this to be the cause. IX checked with AOR 800o in V6 on Wideband am around 29.1 MHz. SUBJ had IX on TV chl 2 rabbit ears in their master bedroom where blanket was located. TV on rabbit ears in garage had no IX, since too far away and s/n ratio probabaly covered IX.

Totals Hours / Travel - 1.0 2.0 \$0.00

wed - 11/4/05 rude [C | Surpeum ut lived E 500304 335 m 13460 reale in thing Rotting Rome charges

